INSPECTACAR

INSPECTION KARWAO BEFIKR HOJAO

INSPECTION REPORT

PRELIMINARY INFORMATION

Vehicle Name	Nissan
Vehicle Model	Serena
Vehicle Variant	S-Hybrid
Model Year	2007
Transmission	Automatic
Engine Capacity	1.5 L
Fuel Type	Hybrid
Body Color	Silver
Mileage	238,087 km
Registered Number	ZEA-1249
Registered Region	Islamabad
Chassis Number	VU-2-036015
Engine Number	HR15-
Inspection Location	Islamabad
Inspection Date	22nd April 2024

OVERALL RATING

53%

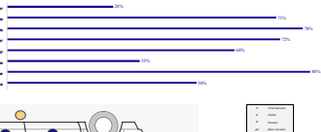

Car Schematic

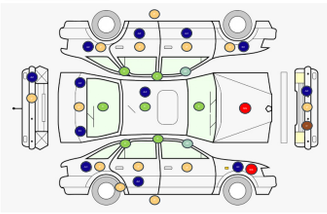

A	Front Bumper
B	Hood
C	Windshield
D1	Mirror Scratch
D2	Door Scratch
D3	Mirror Chipped
D4	Mirror Dent
D5	Door Dent
D6	Lamp Broken
D7	Lamp Scratched
D8	Dry Scratched
D9	Mirror Scratched
D10	Mirror Broken
D11	Mirror Fingerprinted
D12	Mirror Chipped
E	Bonnet
F	Fender
G	Front Door
H	Front Door
I	Fingerprint
J	Fender Scratched

Comments

Core support is bit and repaired. Steering wheel needs service. Steering wheel buttons not working. A/C needs service. Engine block has noise. Airbag light is not showing in cluster.

Accidental Checklist

Engine Room Firewall	Non-Accidented	
Right Side Frame	Non-Accidented	
Left Rear Frame	Non-Accidented	
Right Front Rail	Non-Accidented	
Left Front Rail	Non-Accidented	
Radiator Core Support	Accidented	Dented
Right A Pillar	Non-Accidented	
Left A Pillar	Non-Accidented	
Right B Pillar	Non-Accidented	
Left B Pillar	Non-Accidented	
Right C Pillar	Non-Accidented	
Left C Pillar	Non-Accidented	
Roof Panel	Non-Accidented	
Trunk Floor	Non-Accidented	Corroded
Trunk Lockdown	Non-Accidented	Corroded

Mechanical Function

Engine Abnormal Noise	Black Noise Present
Engine Smoke	Not Present
Engine Smoke Color	N/A
Engine Stress	Not Present
Engine Oil Leakage	Not Present
Coolant Leakage	Not Present
Power Steering Oil Leakage	Not Present
Transmission Oil Leakage	Not Present
Exhaust Sound	Normal Sound
Cooling	Working
Cooling Fan	Working
Gear Transmission	Smooth

A/C and Heater Operation

A/C Installed	Yes
A/C Gas	Working
Blower Blower	Abnormal
A/C Cooling	Low Cooling
Cooling	Working

Interior

Steering Wheel Wear And Tear	Not Present
Steering Wheel Remote	Not Working
Cabin Lower Switch	Working
Sunroof	Not Present
Dash Control Buttons	Working
Interior Lights	Working
Fog Lamps	Working
Headlamps	Working
Tail Lamps	Working
Front View Camera	N/A
Electric Restriction	Working
Tail Lamp Bulbous Lower	Working
Tail Lamp Bulbous Lower	Working
Side Lower Mirror Adjustment	Working
All Indicator Lights Mirror	Normal
Cabin Indicator Mirror	Normal
Steering Indicator Mirror	Working
Air Bag	Normal
Cabin Fabric	Excellent Point
Cabin Panel	Respective
Seats Panel	Fit
Seats Type	Leather
Air Conditioner	Clean
Driver Seatbelt	Working
Passenger Seatbelt	Working
Dashboard Light	Working
Front Driver Window	Working
Front Passenger Window	Working
Rear Driver Side Window	Working
Rear Passenger Side Window	Working
Windows Auto Lock Button	Working
Sunroof Locking	Working
Fog Buttons	N/A
Cabin Odor	Present
Front Driver Door Seal	Required
Front Passenger Door Seal	Original
Rear Driver Side Door Seal	Original
Rear Passenger Side Door Seal	Original
Bonnet Seal	Original
Trunk Seal	Original

Electronic Function

Horn	Strong
Wipers	Working
Right Headlight Operation	Working
Right Headlight Condition	Faded and Damaged
Left Headlight	Original
Left Headlight Operation	Working
Left Headlight Condition	Faded and Damaged
Left Headlight	Original
Left Indicator Operation	Working
Left Tail Light Operation	Working
Left Tail Light Condition	Faded
Left Tail Light	Original
Right Tail Light Operation	Working
Right Tail Light Condition	Faded and Broken
Right Tail Light	Original
Windshield Wipers	Working
Fuses	Present
Dash Lights	Off

Suspension Function

Steering Assembly Play	Present
Left Bushes	Normal
Right Ball Joint	Normal
Left Ball Joint	Normal
Tie Rod End	Normal
Left Rear	Normal
Left Rear	Normal
Left Hub	Normal
Left Hub	Normal
Front Right Shock Absorber	Normal
Front Left Shock Absorber	Normal
Rear Right Shock Absorber	Normal
Rear Left Shock Absorber	Normal

Exterior Body

Hatch Lock	Working		
Front Bumper Condition	N/A	A3	
Grill	N/A		
Hood Scratched	Y		
Front Passenger Fender	P	A3	
Front Passenger Door	P	A3	
Rear Passenger Door	P	A3	
Rear Passenger Fender	P	A3	
Roof	A3		N6
Rear Windshield	Y		
Rear Driver Fender	P	A3	
Rear Driver Door	P	A3	
Front Driver Door	P		
Roof	Y	A3	
Bonnet	Y		
Driver A Pillar	PP		
Driver B Pillar	Y		
Driver C Pillar	Y		
Driver D Pillar	Y		
Passenger A Pillar	PP		
Passenger B Pillar	Y		
Passenger C Pillar	Y		
Passenger D Pillar	Y		
Front Bumper	P	A1	N3
Rear Bumper	P	A3	

A	Front Bumper
B	Hood
C	Windshield
D1	Mirror Scratched
D2	Mirror Scratch
D3	Mirror Chipped
D4	Mirror Dent
D5	Door Dent
D6	Lamp Broken
D7	Lamp Scratched
D8	Dry Scratched
D9	Mirror Scratched
D10	Mirror Broken
D11	Mirror Fingerprinted
D12	Mirror Chipped
E	Bonnet
F	Fender
G	Front Door
H	Front Door
I	Fingerprint
J	Fingerprint Fingerprint

Tyres

Front Passenger Tyre Brand	COMPASSAL
Front Passenger Tyre Size	195/65R15
Front Passenger Tyre Condition	Average
Front Driver Tyre Brand	COMPASSAL
Front Driver Tyre Size	195/65R15
Front Driver Tyre Condition	Average
Rear Passenger Tyre Brand	COMPASSAL
Rear Passenger Tyre Size	195/65R15
Rear Passenger Tyre Condition	Average
Rear Driver Tyre Brand	COMPASSAL
Rear Driver Tyre Size	195/65R15
Rear Driver Tyre Condition	Average
Offer Rims	Yes

Accessories

Spare Wheel	Present
Car Jack	Present
Jack Handle	Present
Collision Airbags Are	N/A

Test Drive

Engine Pull	Normal
Gear Shifting	Normal
Differential Noise	No
Gear Shift Noise	No
CRP Activation	Timely Response
Gear Partial Disconnection	Timely Response
Front Suspension Noise	Not Present
Rear Suspension Noise	Not Present
Steering Function	Requires Service
Steering Wheel Alignment	Centered
Instrument Information Clusters	Working
Test Drive Disease Bit	Inspector

Car Pictures

THANK YOU FOR CHOOSING

INSPECTACAR

Contact Number	0317 - 171 - 3868
Email	info@inspectacar.com.pk
Facebook	fb.com/inspectacarpk
Website	www.inspectacar.com.pk

DISCLAIMER

Across a body panel, it remains unclear whether the paint thickness is consistent, suggesting the possibility of a full or partial repaint. Furthermore, the presence of minor paint chips and scratches, commonly attributed to aftercare, raises questions about the vehicle's overall condition. Without detailed inspection, it's challenging to ascertain the extent of any repaintwork and its potential impact on the vehicle's overall condition. Consequently, we recommend a thorough inspection by a qualified mechanic to accurately assess the vehicle's condition and any potential repaintwork.

This report is based on the condition of the vehicle at the time and date of inspection and provides only an estimation of the condition of the vehicle and its various components. It does not guarantee the future performance or condition of the vehicle. The inspection team does not assume the conditions of parts not visible or not inspected during the inspection of the vehicle.

This report is in no way a warranty, nor is it a guarantee, of the condition of the car. All opinions and comments are based on visual inspection and functional assessments. Inspection and functions, performed within the limited time available, may circumvent some of the issues, defects, or malfunctions, or missing items.